


Top View

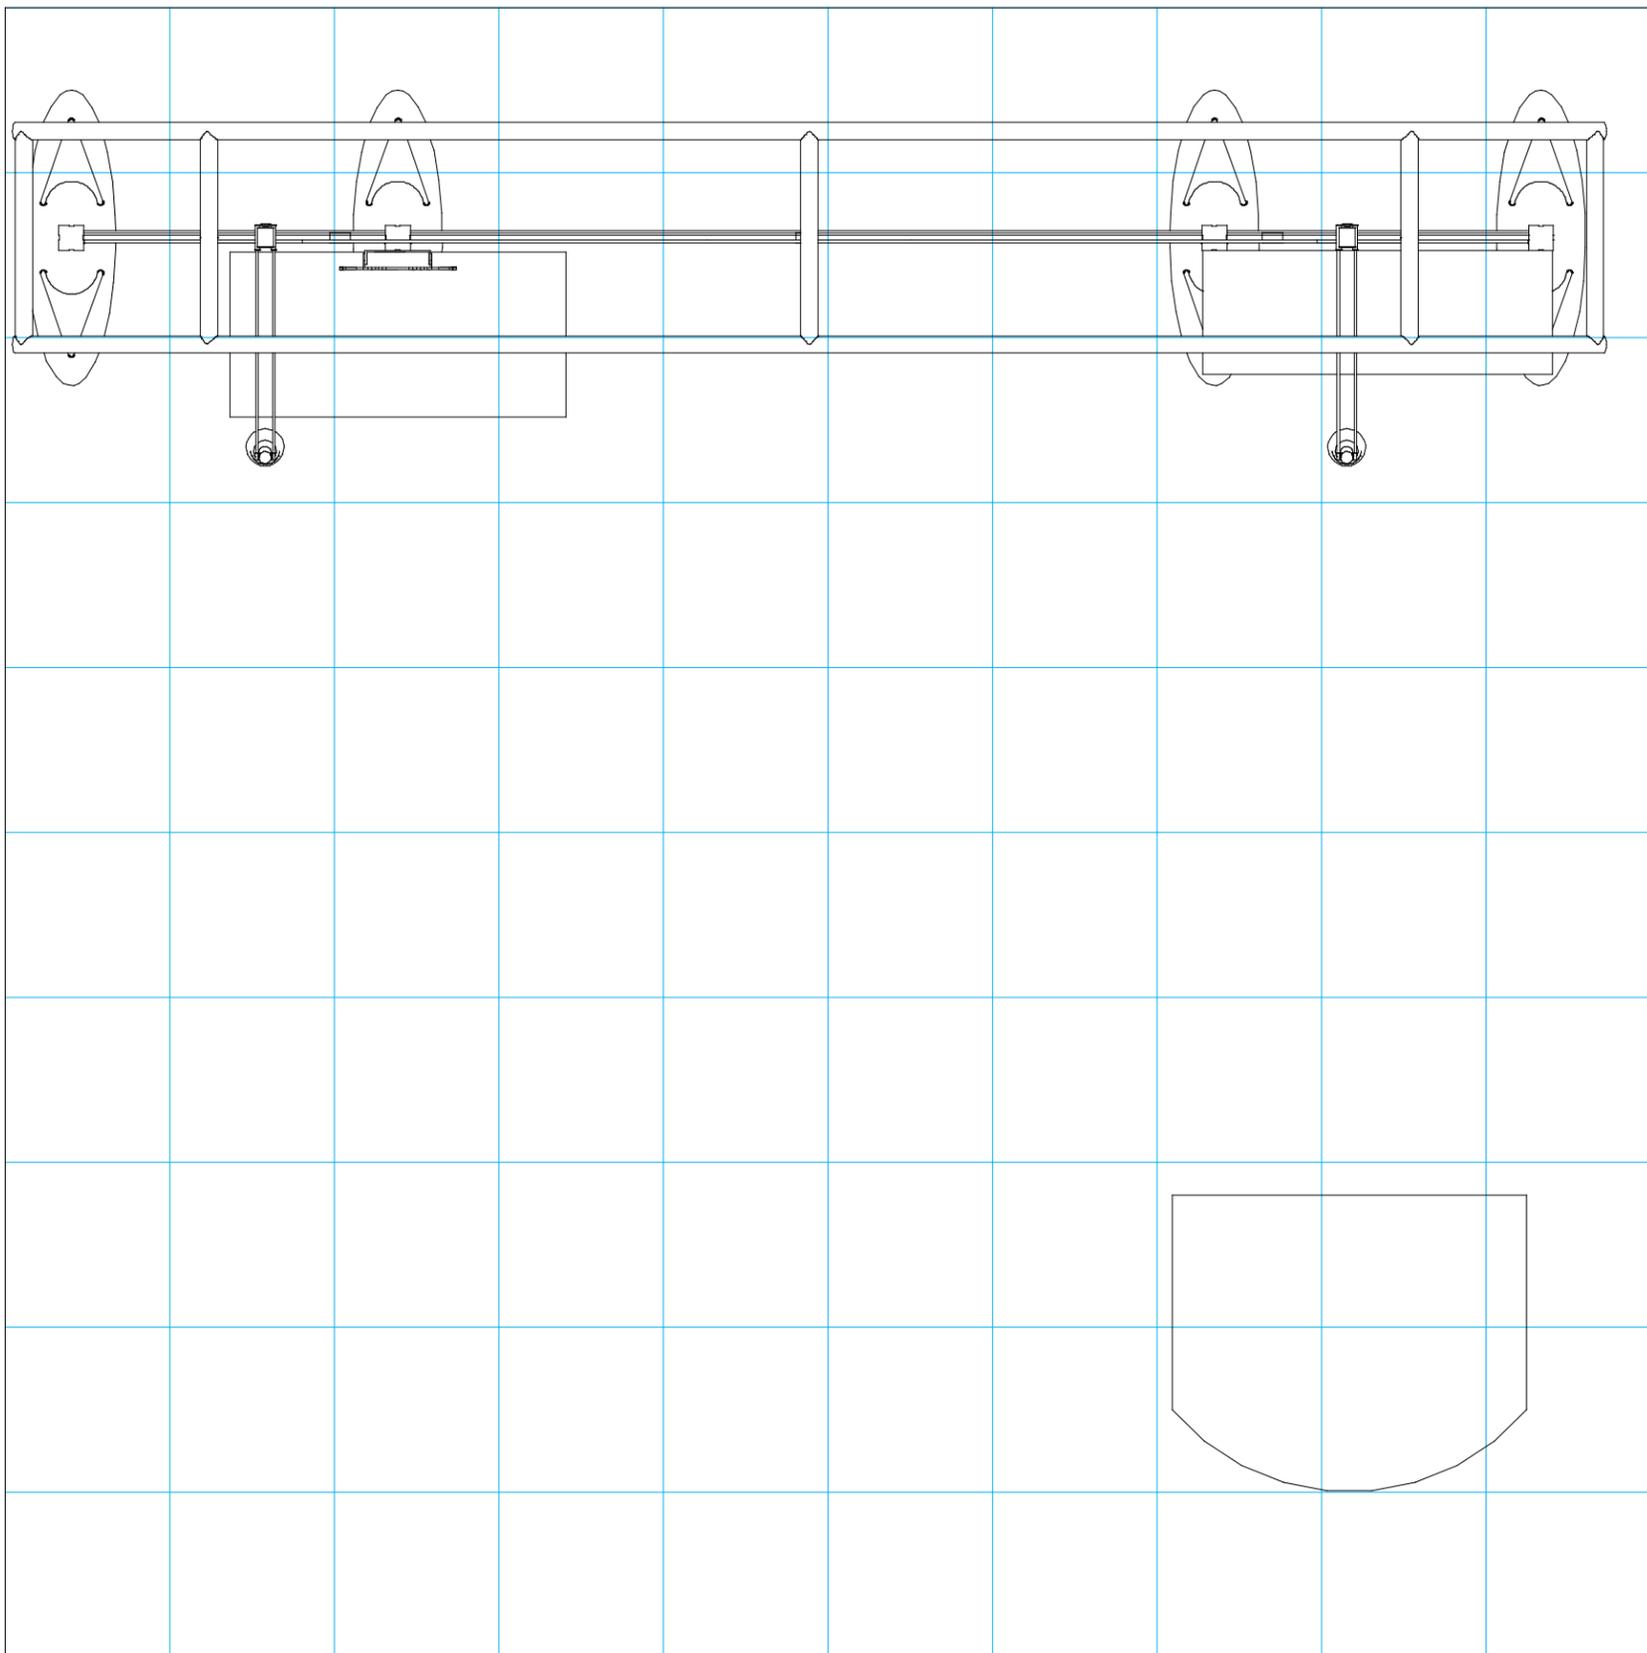

= 1 sq foot

General Setup Instructions


- Read entire setup instruction manual prior to unpacking parts and pieces.
- The setup instructions are created specifically for this configuration.
- Setup instructions are laid out sequentially in steps, including exploded views with detailed explanation for assembly.

Cleaning & Packing


- For Cleaning Metal, Plex, & Laminate Parts: Use a **MILD NON-ABRASIVE** cleanser and soft cloth/paper towel to clean all surfaces.
- Keep exhibit components away from heat and prolonged sun exposure. **Heat and UV exposure will warp and fade components.**
- Retain all provided Packing Materials. All provided packing materials are for ease of repacking & component protection.

Disassembly


- For loss prevention, tighten all set screws and locks during disassembly.

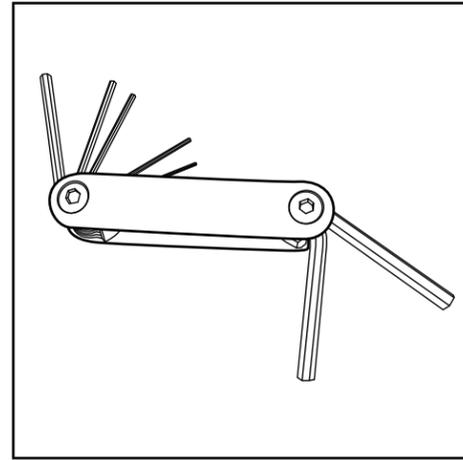


Hex Tool - Essential for Assembly

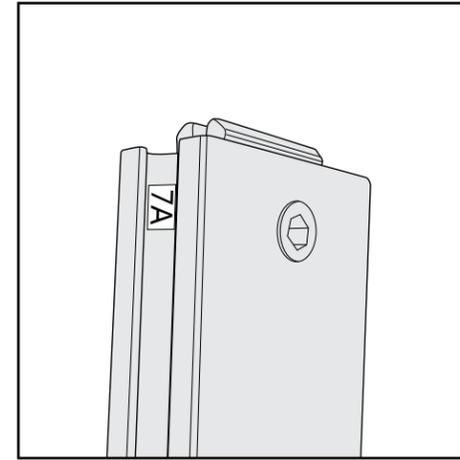


Part Identification - Numbering

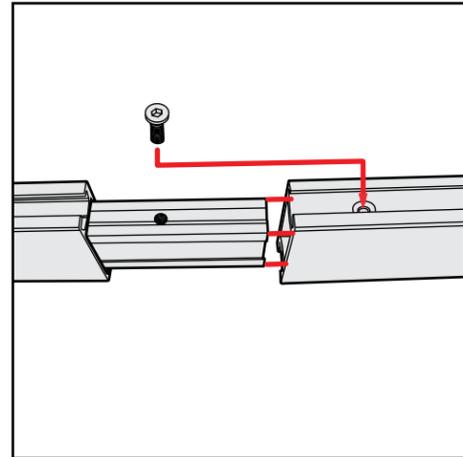


Spline Connection

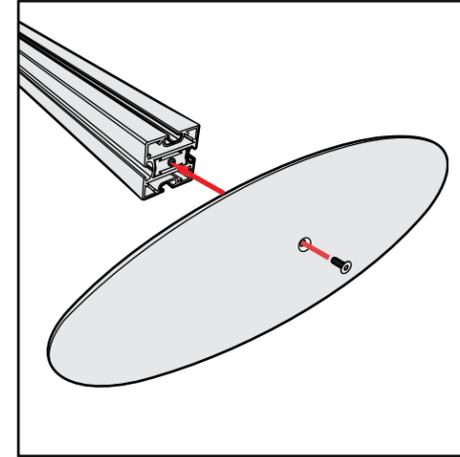

Base Plate & Extrusion Connection

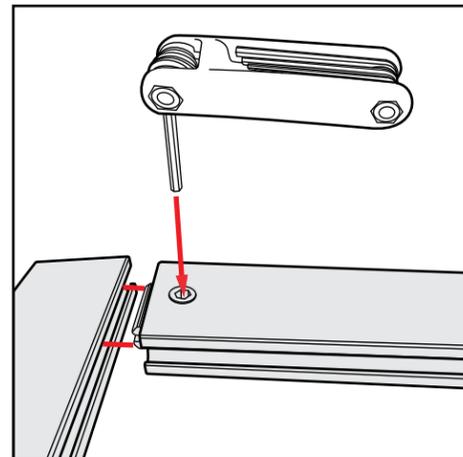

Extrusion & Lock Connection

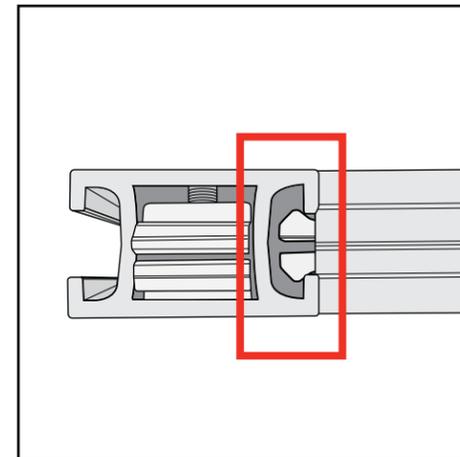

Engaged Lock



WARNING



DO NOT USE POWER TOOLS



LADDERS OR LIFTS
MAY BE REQUIRED




ALL CONNECTIONS MUST
BE TIGHTLY SECURED

CRATE PACKING




Item	Qty.	Description
1	4	Base Plate
2,2A	1,1	42" S44 Vertical Extrusion w/ PR37
3,3A	1,1	42" S44 Vertical Extrusion w/ PR37
4,4A	1,1	42" S44 Vertical Extrusion w/ PR37
5,5A	1,1	42" S44 Vertical Extrusion w/ PR37
6	1	22" Z45 Horizontal Extrusion
7	1	22" Z45 Horizontal Extrusion
8,8A	1,1	28.875" Z45 Horizontal Extrusion
9,9A	1,1	28.875" Z45 Horizontal Extrusion
10	1	22" Z45 Horizontal Extrusion
11	1	22" Z45 Horizontal Extrusion

- Steps:
- 1) Connect vertical extrusions [2-2A], [3-3A], [4-4A], [5-5A] together.
See [S44 Connection](#) detail.
 - 2) Attach base plates [1] to vertical extrusions, using bolts.
 - 3) Attach horizontals [8] to [8A] and [9] to [9A].
See [Z45 Connection](#) detail.
 - 4) Connect horizontals [6,7,8/8A,9/9A,10,11] between vertical assemblies as shown.
 - 5) Affix graphics to back of backwall assembly, using Velcro.

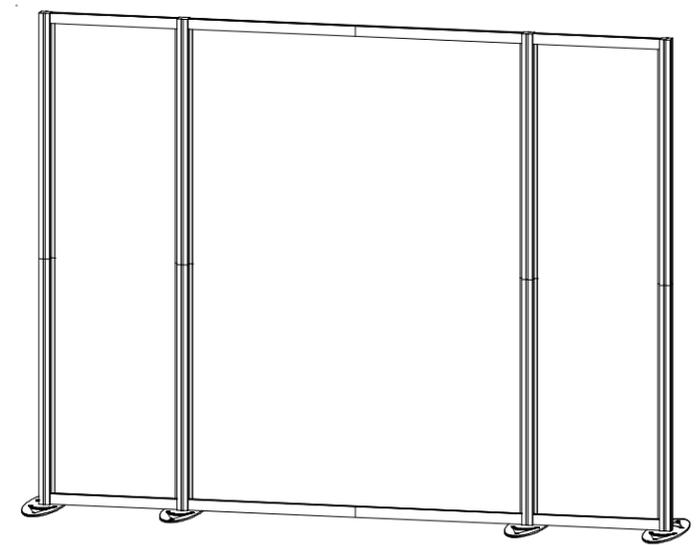

When assembled

Assemble frame flat on ground.

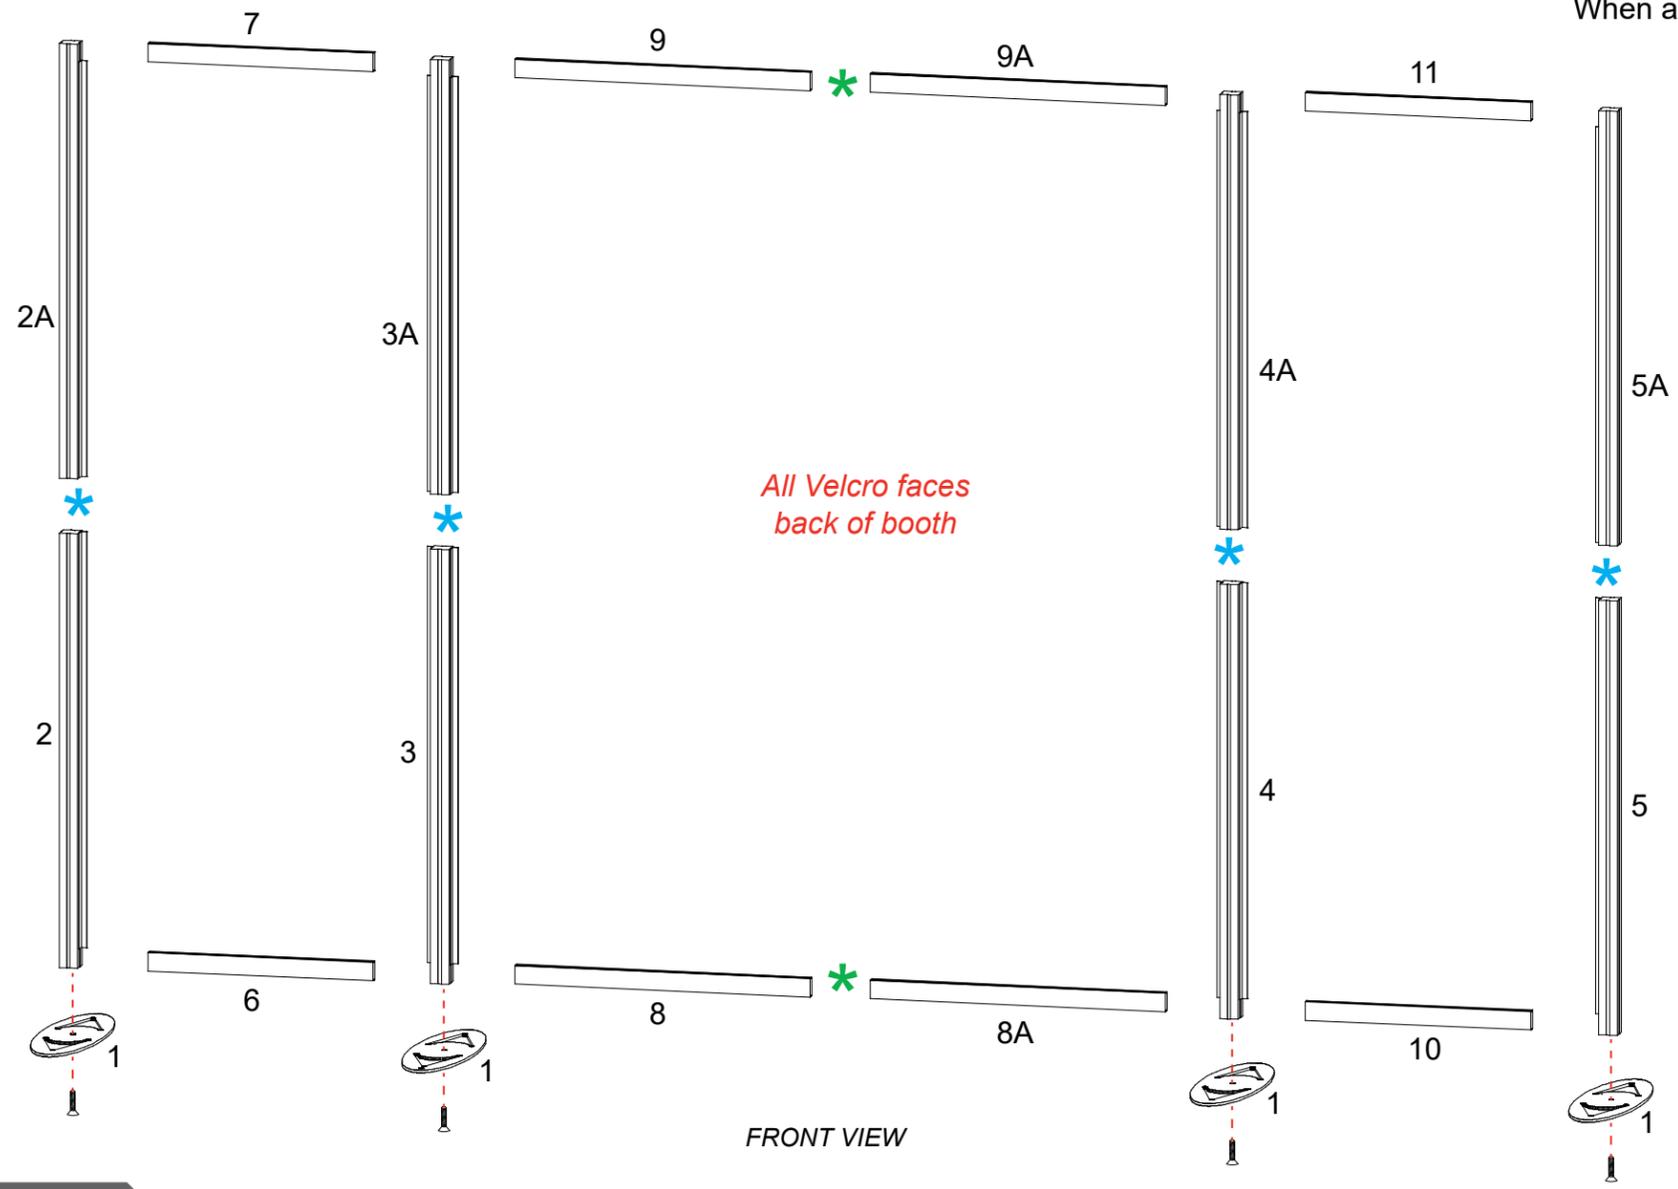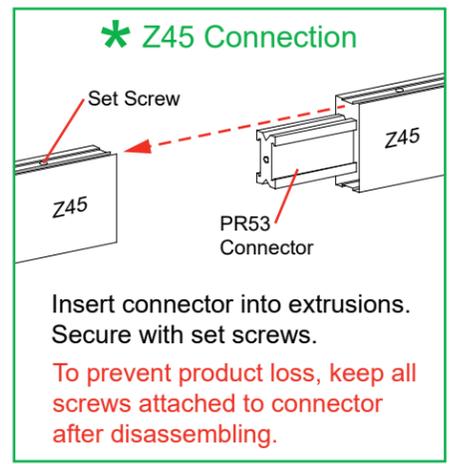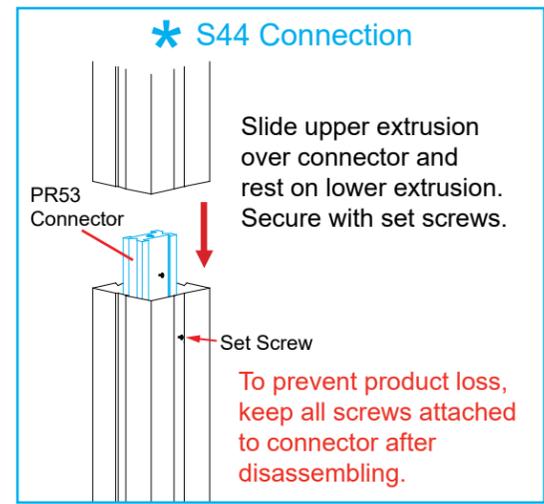

AERO


Using Your Setup Instructions

The Aero Setup Instructions are created specifically for your configuration. The instructions include an exploded view of the frame which is sequentially labeled. We encourage you to review the instructions before attempting to assemble your exhibit.



Connections are kept very simple; no tools required. Everything assembles with push-button connectors.

Cleaning and Packing Your Display

- 1) Use care when cleaning aluminum extrusion or acrylic inserts. Use only non-abrasive cleaners.
- 2) Retain all packing material. It will make re-packing much easier and will reduce the likelihood of shipping damage.


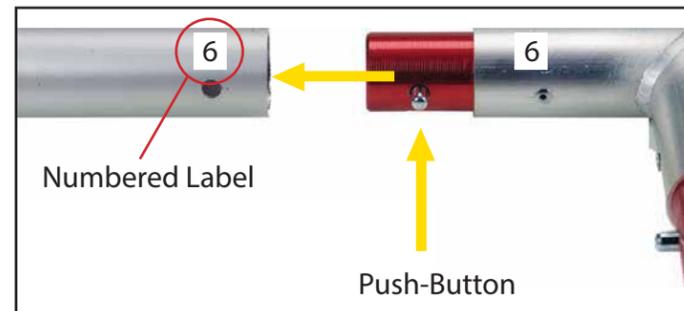


Connections are made by holding the button down and sliding the red tube into opposing tube until button locks into the hole of the opposing tube. To disassemble, push button and pull or twist extrusions apart.

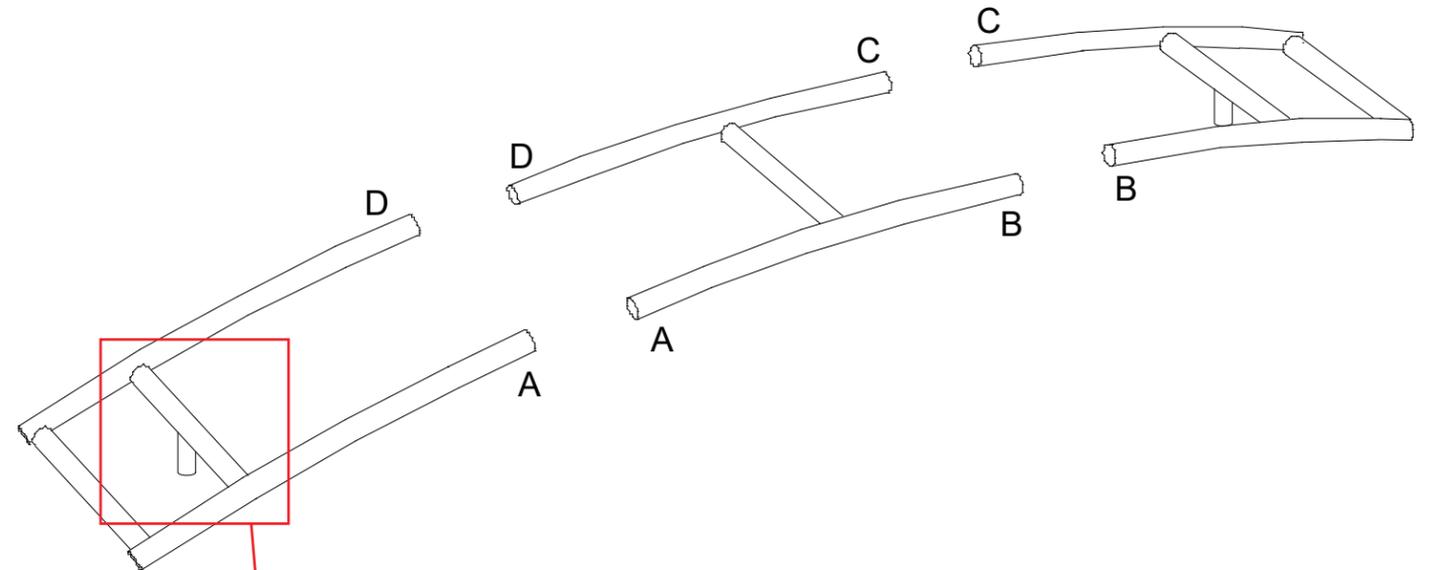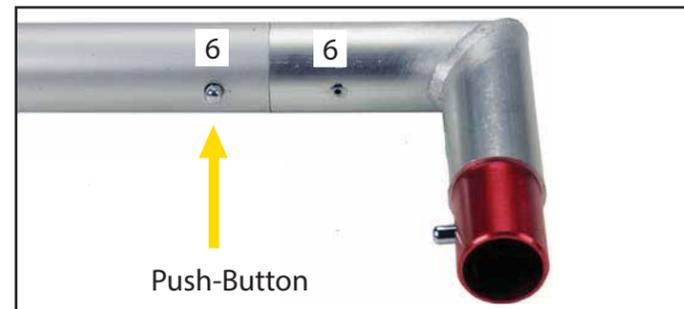

Steps:



- 1) Connect canopy pieces together as shown.
- 2) Slide fabric cover over assembled canopy then zip closed.

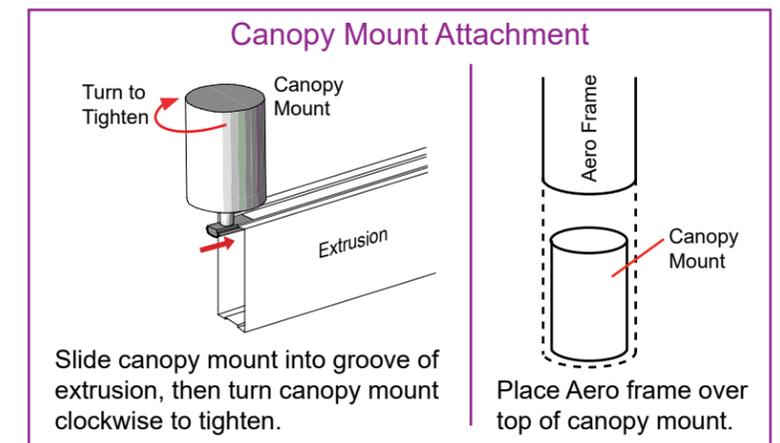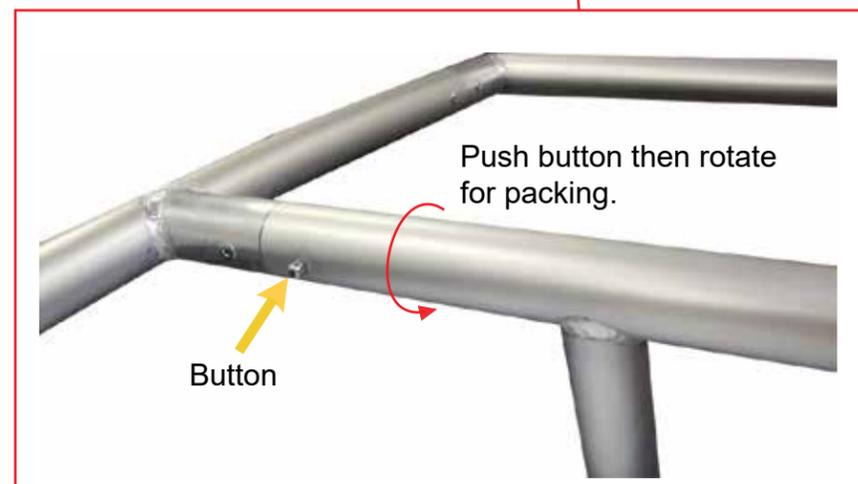

Steps:

- 1) Attach clamps to [7] [9/9A] and [11]. See **A10 Clamp** detail. Clamp header to top of assembled backwall.
- 2) Attach lights, where desired, to top of assembled backwall. See **Light Attachment** detail.
- 3) Attach canopy mounts to [7] and [11]. See previous page for **Canopy Mount Attachment** detail. Place assembled canopy onto canopy mounts, with zipper facing to back.
- 4) Attach counter top between extrusions [3] and [12].
- 5) Attach shelves to [4] and [5]. See **Shelf Attachment** detail.
- 6) Attach monitor mount to [3A]. See **Monitor Mount Attachment** detail.

Item	Qty.	Description
12	1	38.414" S40 Angled Extrusion


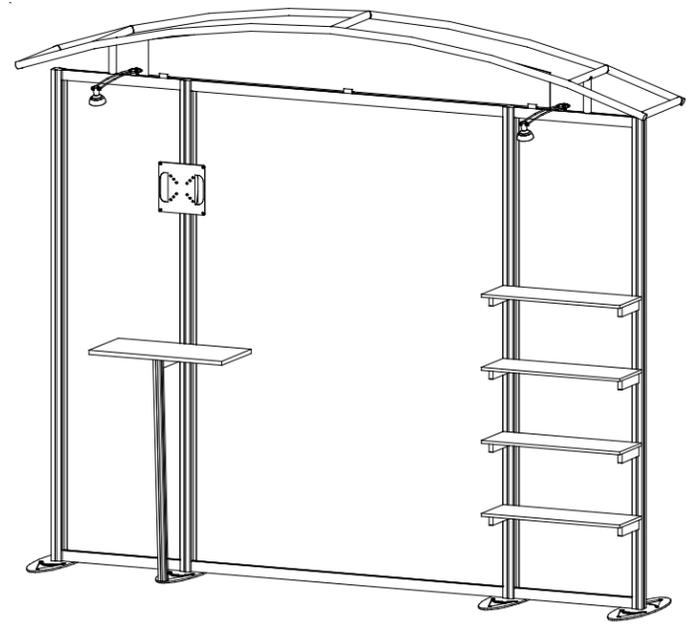
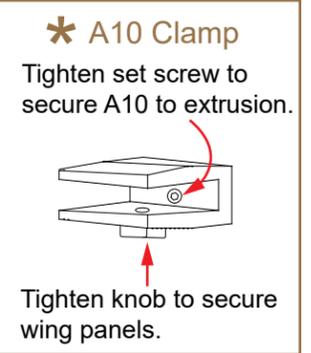


*** Monitor Mount Attachment**

Slide V4 Connectors into groove of Extrusion. Tighten Set Screws to secure connectors in place.


Attach Monitor Mount back piece to Extrusion, using bolts.

Then slide monitor mount into back piece.

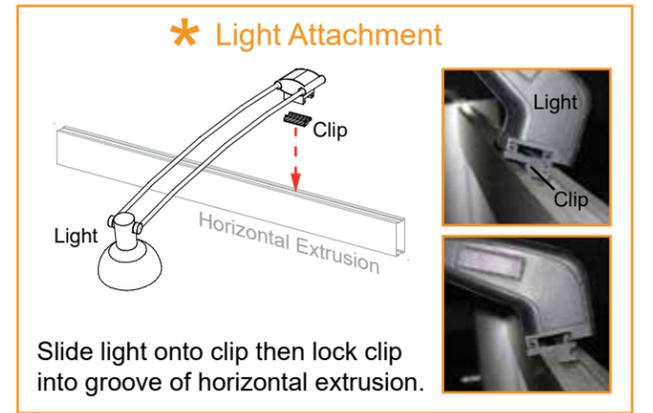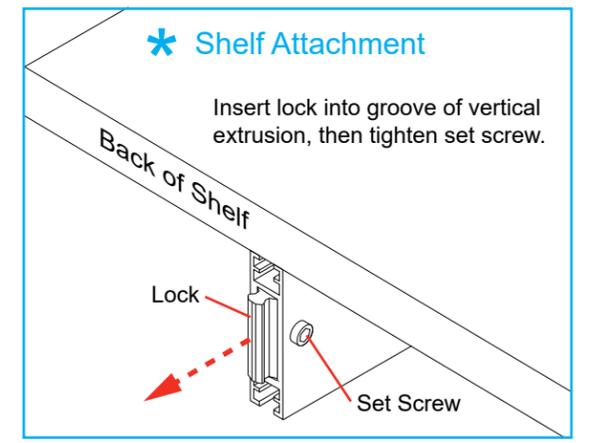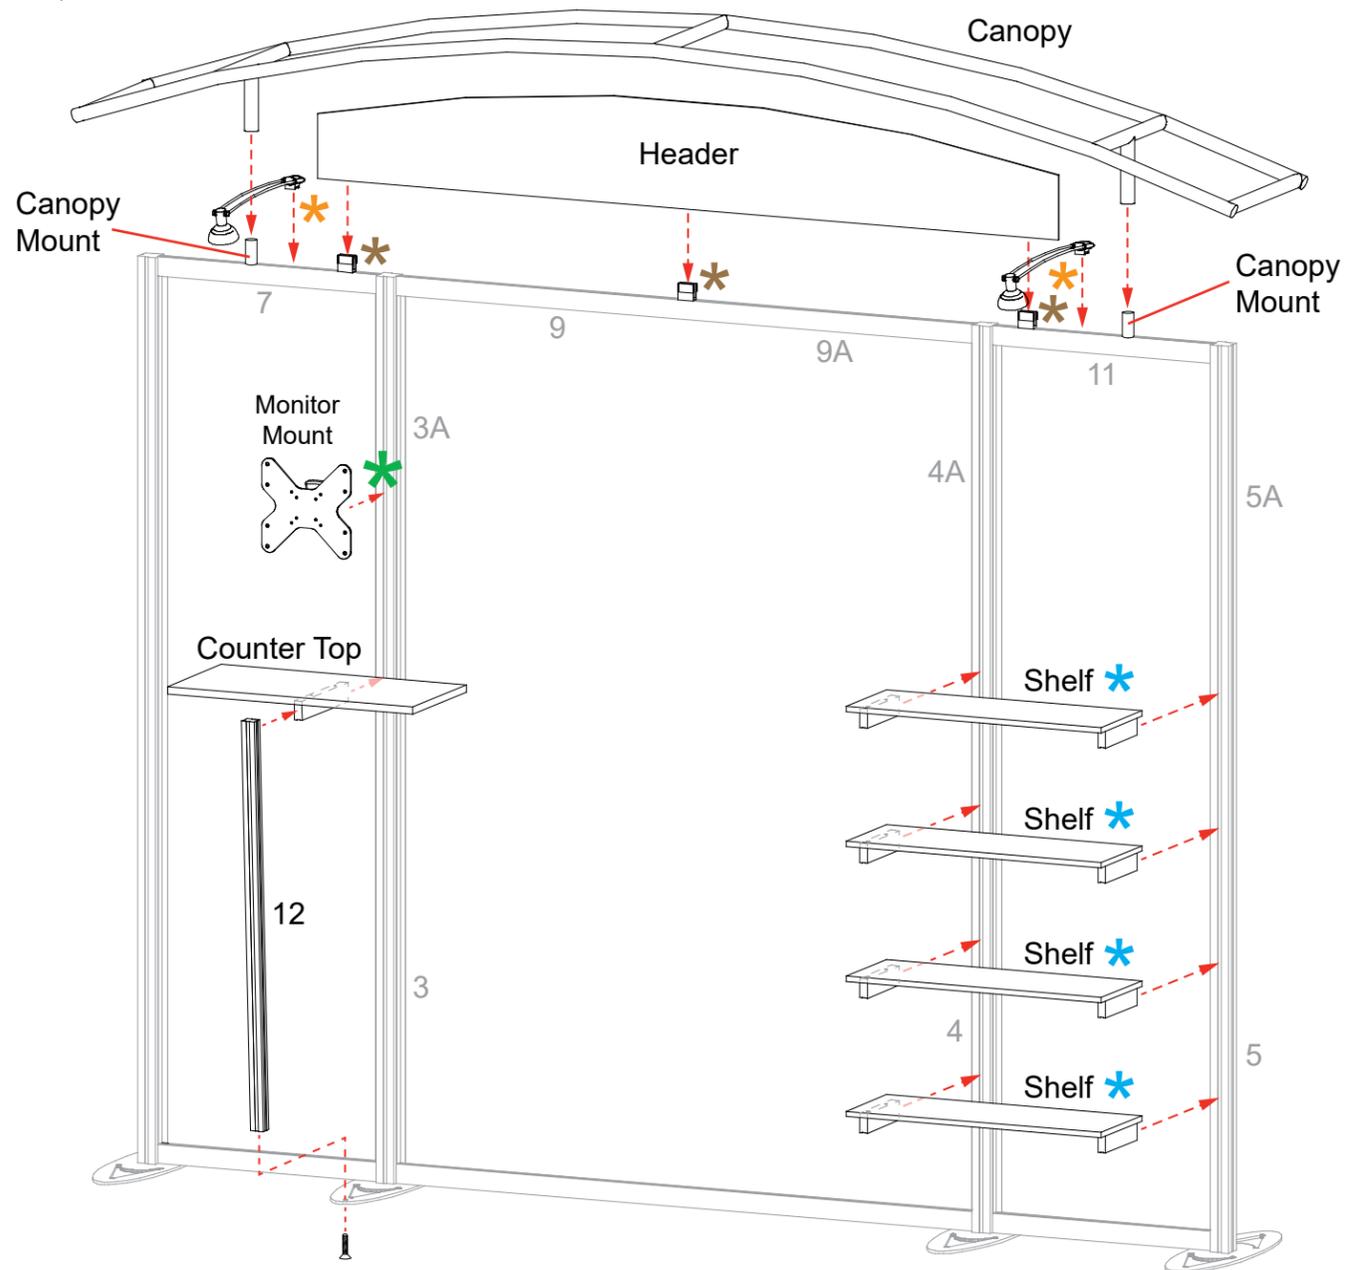

Item	Qty.	Description
1	1	38" GS220 Vertical Extrusion w/ Door Hinges
2	1	38" GS220 Vertical Extrusion w/ Door Stop
3	1	38" GS210 Vertical Extrusion
3A	1	34.417" Z33 Vertical Extrusion
4	1	38" GS210 Vertical Extrusion
4A	1	34.417" Z33 Vertical Extrusion
5	2	22.0197" Z45 Horizontal Extrusion
6,6A	2,2	12.5" Z45 Horizontal Extrusion
7	2	25.639" Z45 Curved Extrusion

- Steps**
- 1) Attach horizontal extrusions [5] and [7] between assemblies [1,4,6,6A] and [2,3,6,6A], making sure Velcro is facing inward.
 - 2) Connect vertical extrusions [3A] and [4A] on top of horizontal extrusion [7].
 - 3) Slide infill between verticals [3A] and [4A].
 - 4) Attach assembled door to vertical extrusion [1]. See **Door Connection** detail.
 - 5) Attach upper horizontal extrusions [5] and [7] between assemblies and on top of infill and door.
 - 6) Connect **shelf supports** to Velcro, then set shelf on top of supports.
 - 7) Attach pedestal top to extrusions [6A]. See **Pedestal Top Attachment** detail.

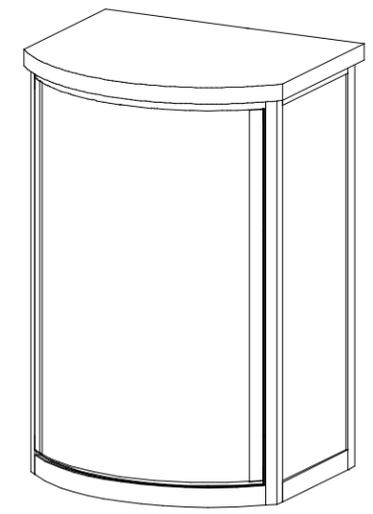

Completed Pedestal Assembly

