



Elevation View

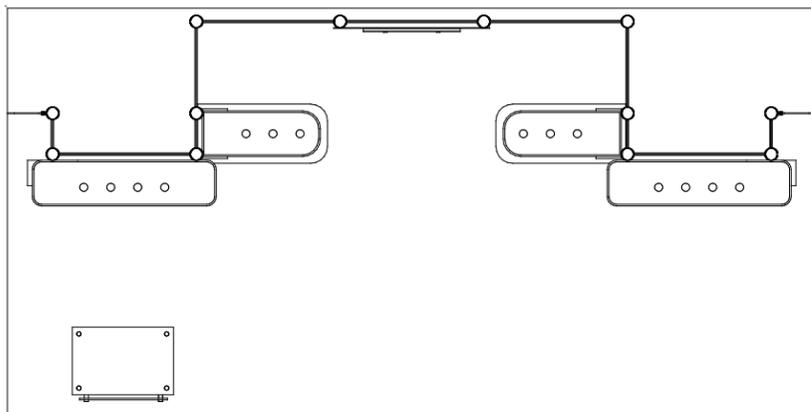

Plan View

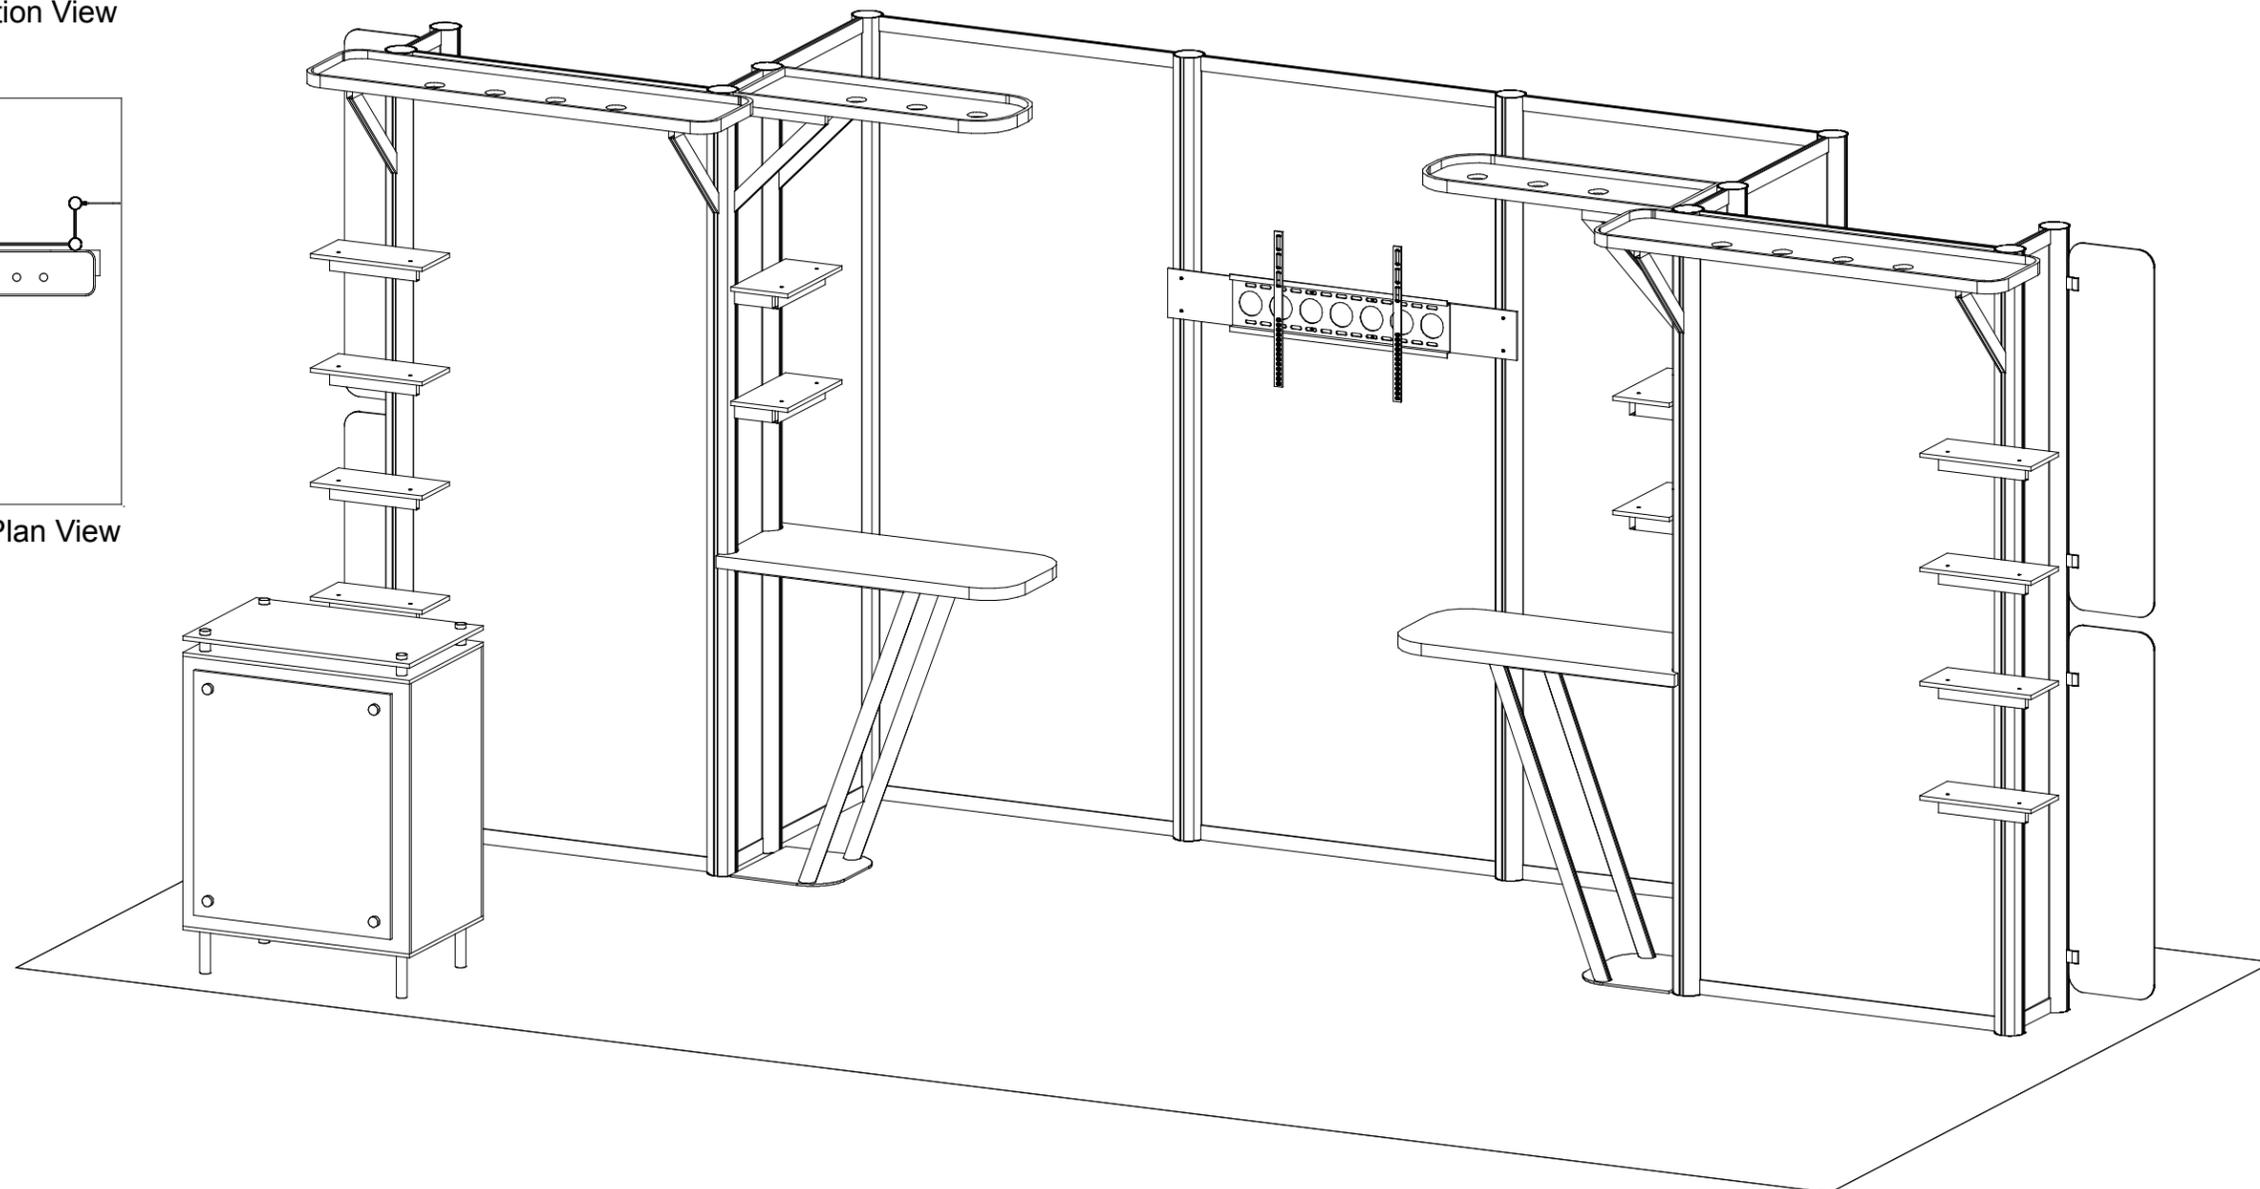

# SETUP INSTRUCTIONS

## General Setup Instructions


- Read entire setup instruction manual prior to unpacking parts and pieces.
- The setup instructions are created specifically for this configuration.
- Setup instructions are laid out sequentially in steps, including exploded views with detailed explanation for assembly.

## Cleaning & Packing


- For Cleaning Metal, Plex, & Laminate Parts: Use a **MILD NON-ABRASIVE** cleanser and soft cloth/paper towel to clean all surfaces.
- Keep exhibit components away from heat and prolonged sun exposure.  
**Heat and UV exposure will warp and fade components.**
- Retain all provided Packing Materials. All provided packing materials are for ease of repacking & component protection.

## Disassembly


- For loss prevention, tighten all setscrews and locks during disassembly

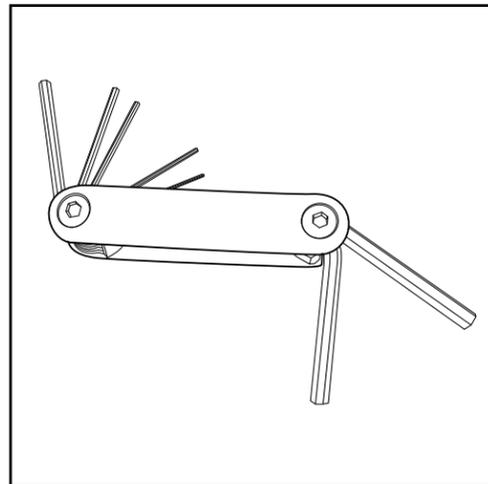


Hex Tool - Essential for Assembly

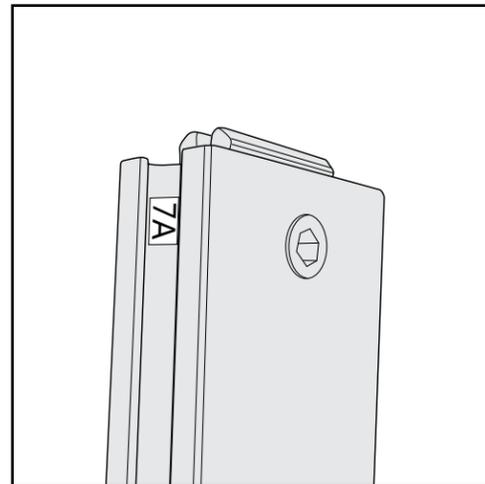


Part Identification - Numbering

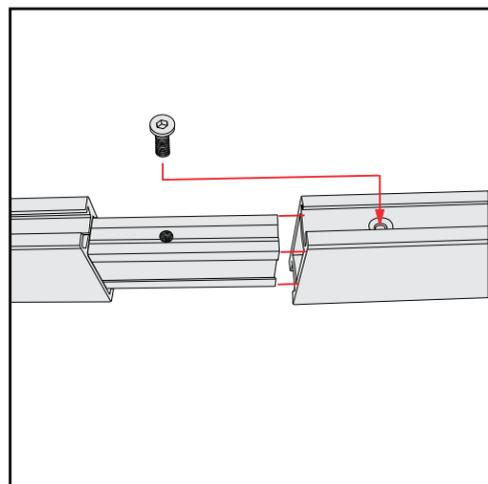


Spline Connection

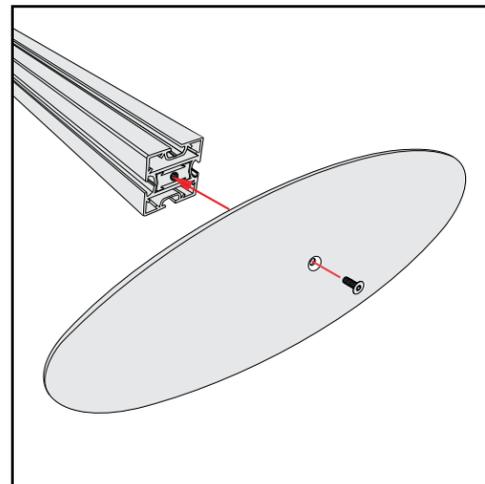

Base Plate & Extrusion Connection

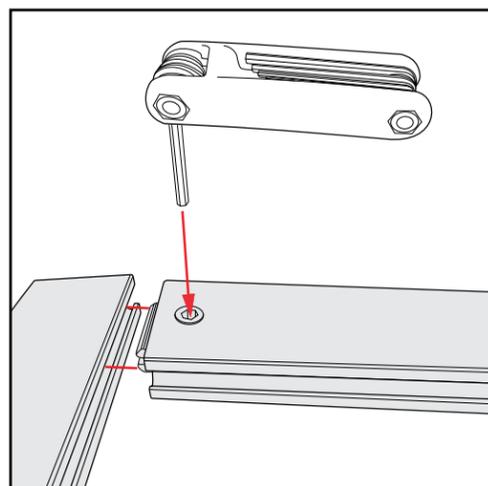

Extrusion & Lock Connection

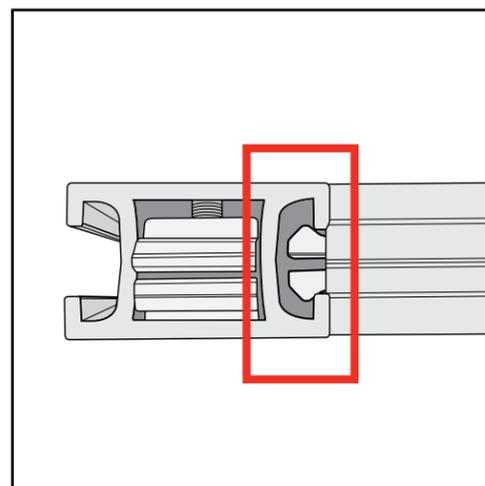

Engaged Lock



**WARNING**



DO NOT USE POWER TOOLS







LADDERS OR LIFTS  
MAY BE REQUIRED



ALL CONNECTIONS MUST  
BE TIGHTLY SECURED



## SEG Graphic Installation

- 1) Locate channels along the edges of extrusions
- 2) Insert graphic corners first into channels then center point of graphic into channels. Allows for proportional fit around the perimeter of the extrusion.
- 3) Working from center to corner, slide silicon edge on graphic into channel.
- 4) After all edges of graphic have been inserted into channels, step back and assess graphic fit, make adjustments where needed.

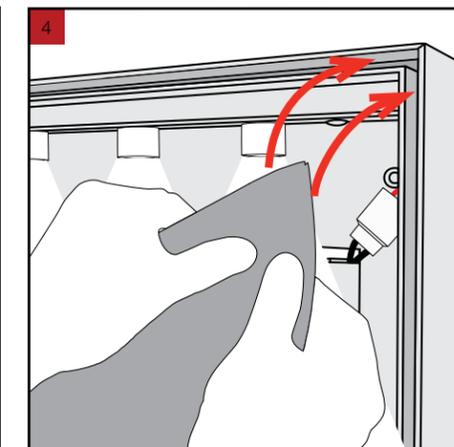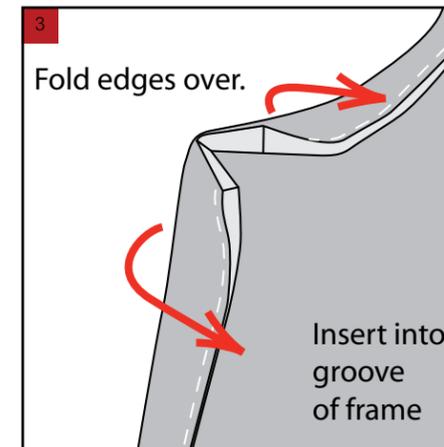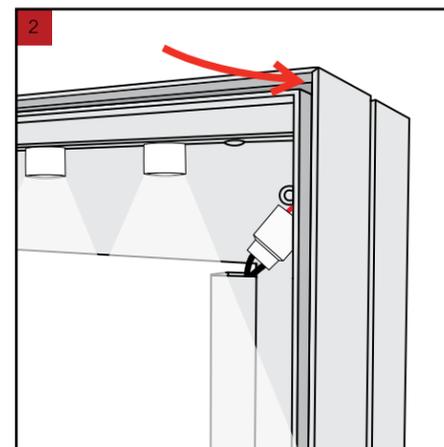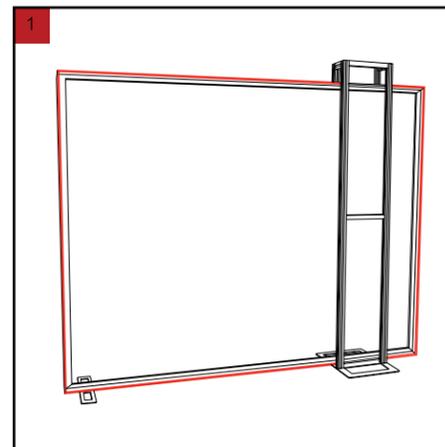

## LT Panel Assembly

- 1) With a vertical offset, place LT-Panels side-by-side; slide vertically offset panel down to lock panels together and in place.
- 2) Corner Connectors (90°, T-Connector, Straight Connector) connect just as panels connect together. Repeat Step 1 for installing corner connectors to panels.

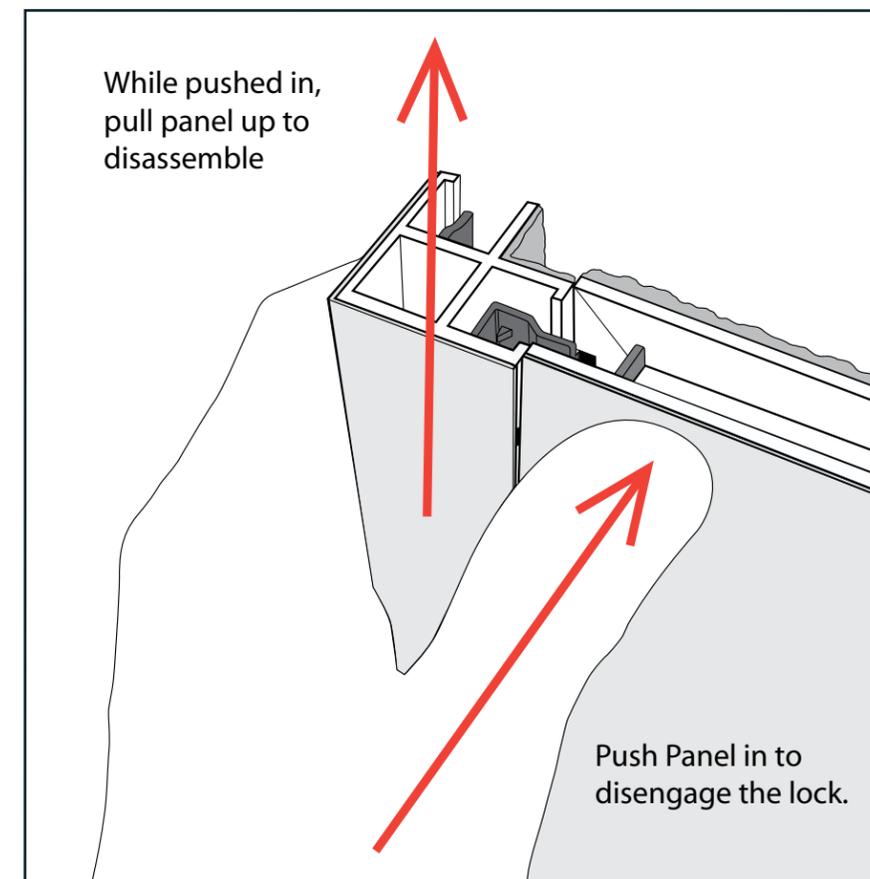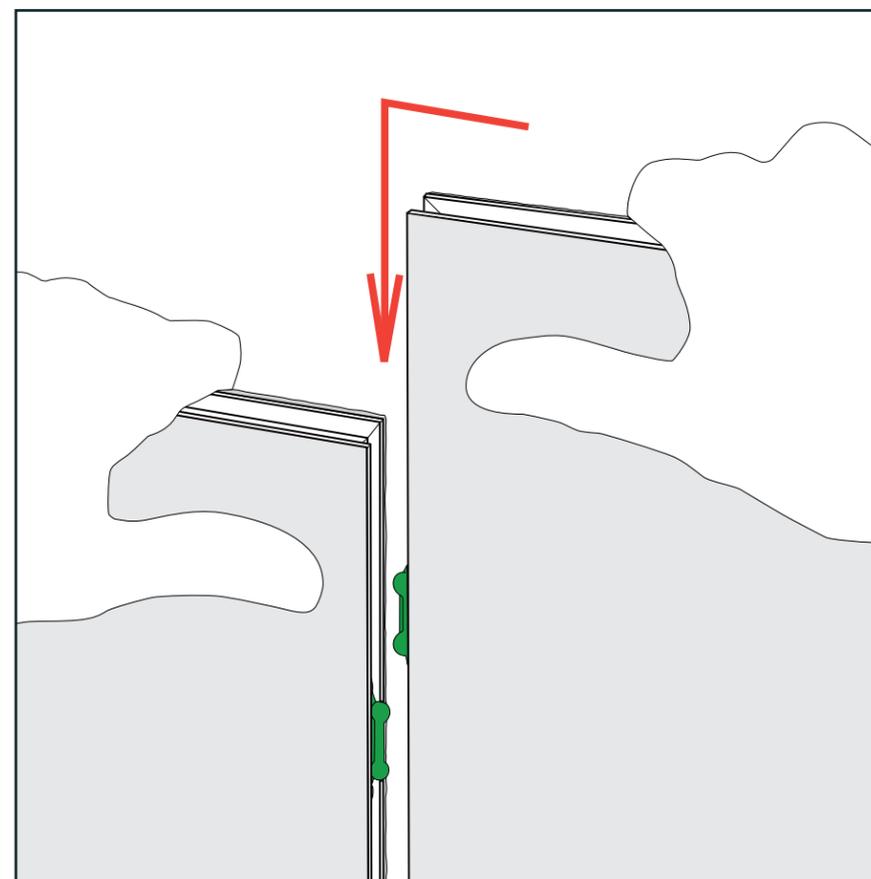


## LT Panel Disassembly

- 1) To disassemble push panel with upper locks horizontally to disengage top lock clip.
- 2) Slide panels or connectors vertically in opposing directions to release latches and disconnect parts.


Item	Qty.	Description
1	1	96" Vertical Extrusion
2A/2B	1/1	8.5" Horizontal Extrusion
3	1	96" Vertical Extrusion
4A/4B	1/1	39" Horizontal Extrusion
5	1	96" Vertical Extrusion
6A/6B	1/1	8.5" Horizontal Extrusion
7	1	96" Vertical Extrusion
8A/8B	1/1	23.5" Horizontal Extrusion
9	1	96" Vertical Extrusion
10A/10B	1/1	39" Horizontal Extrusion
11	1	96" Vertical Extrusion
12A/12B	1/1	39" Horizontal Extrusion
13	1	46.1655" Horizontal Extrusion

Steps:  
1) Connect Horizontals to Verticals in numerical order, including **Infills**.

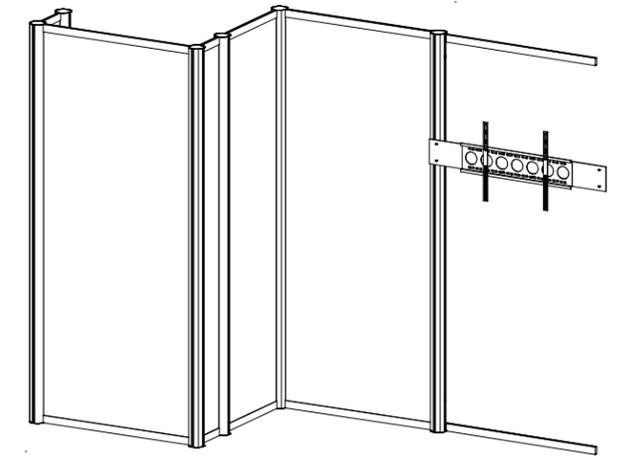


When assembled

LEFT SIDE

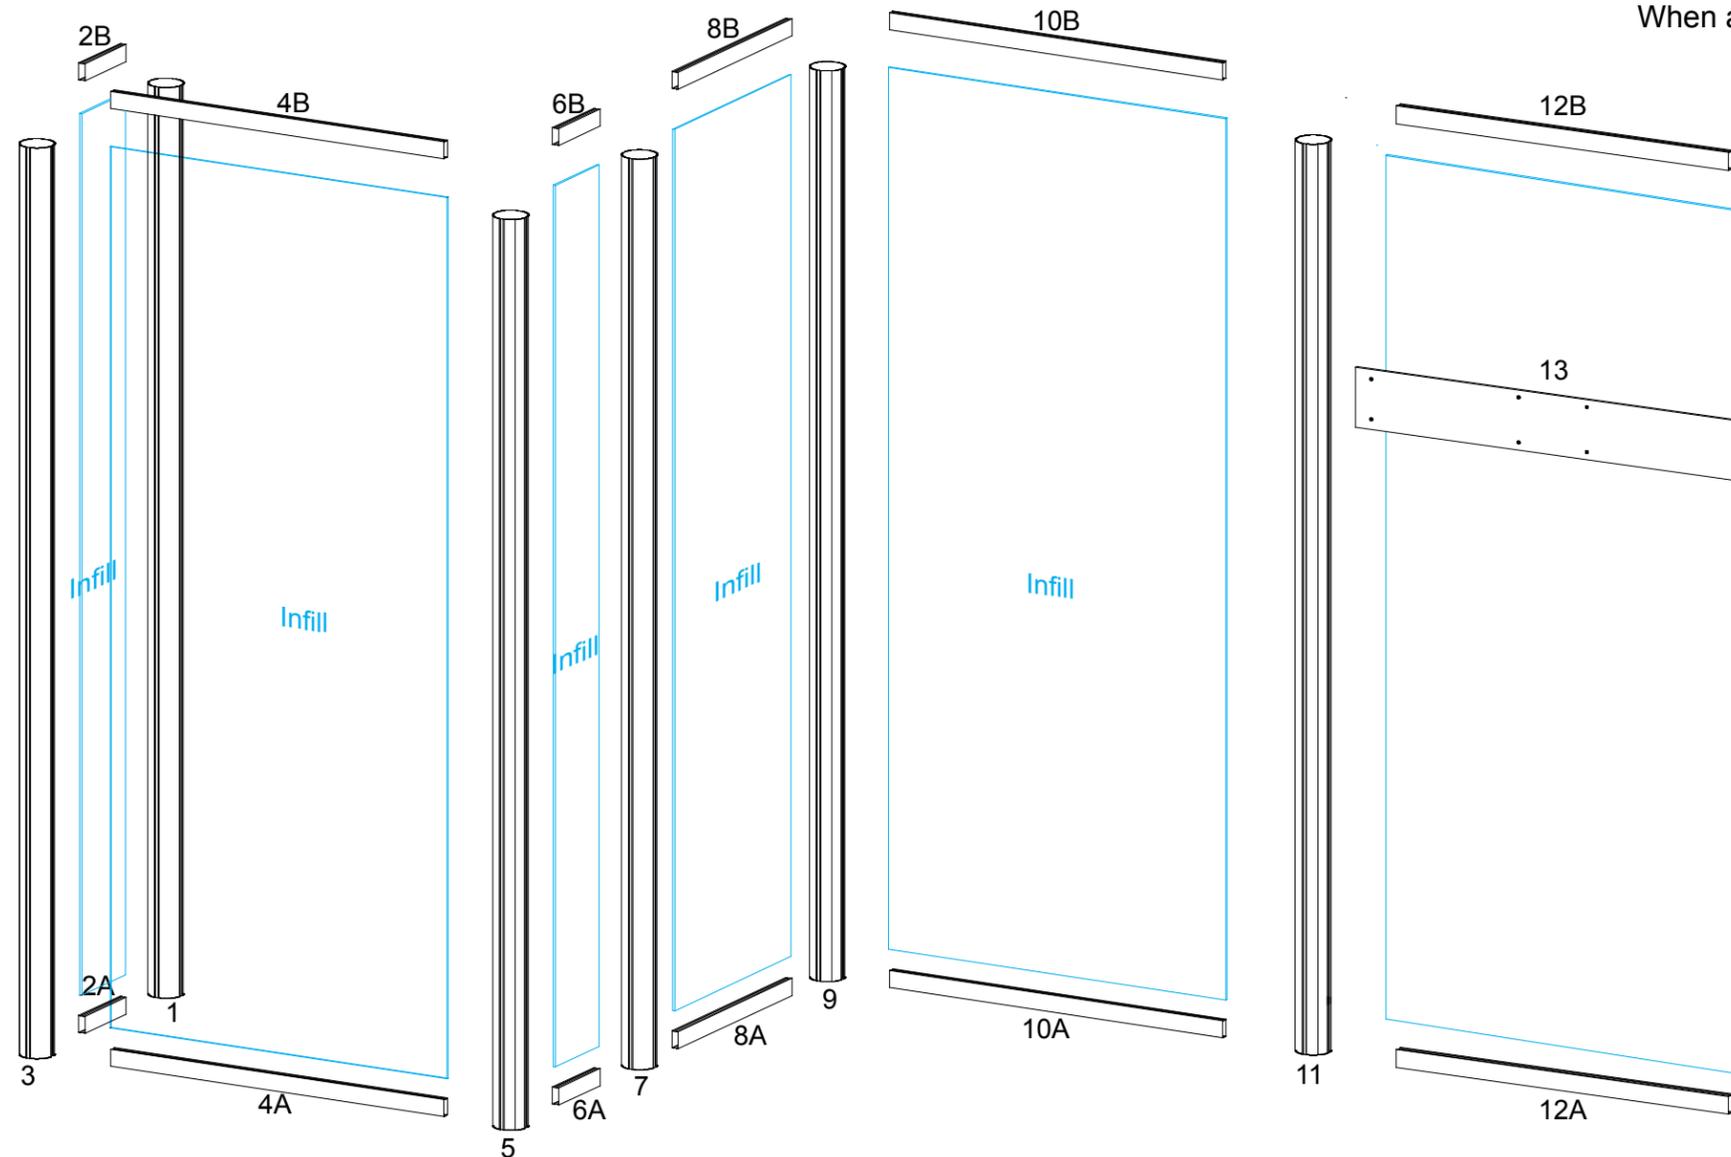


Item	Qty.	Description
1	1	96" Vertical Extrusion
2A/2B	1/1	39" Horizontal Extrusion
3	1	96" Vertical Extrusion
4A/4B	1/1	23.5" Horizontal Extrusion
5	1	96" Vertical Extrusion
6A/6B	1/1	8.5" Horizontal Extrusion
7	1	96" Vertical Extrusion
8A/8B	1/1	39" Horizontal Extrusion
9	1	96" Vertical Extrusion
10A/10B	1/1	8.5" Horizontal Extrusion
11	1	96" Vertical Extrusion

Steps:  
1) Connect Horizontals to Verticals in numerical order, including **Infills**.

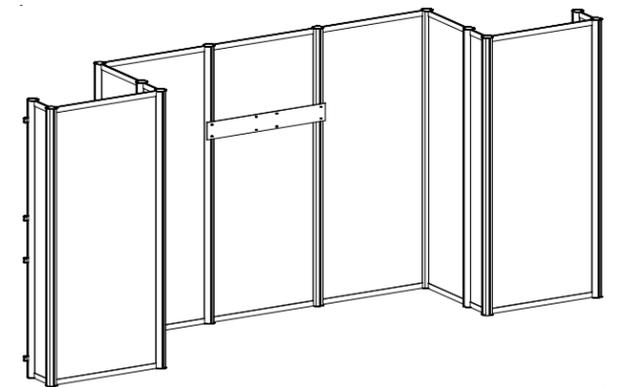


When assembled

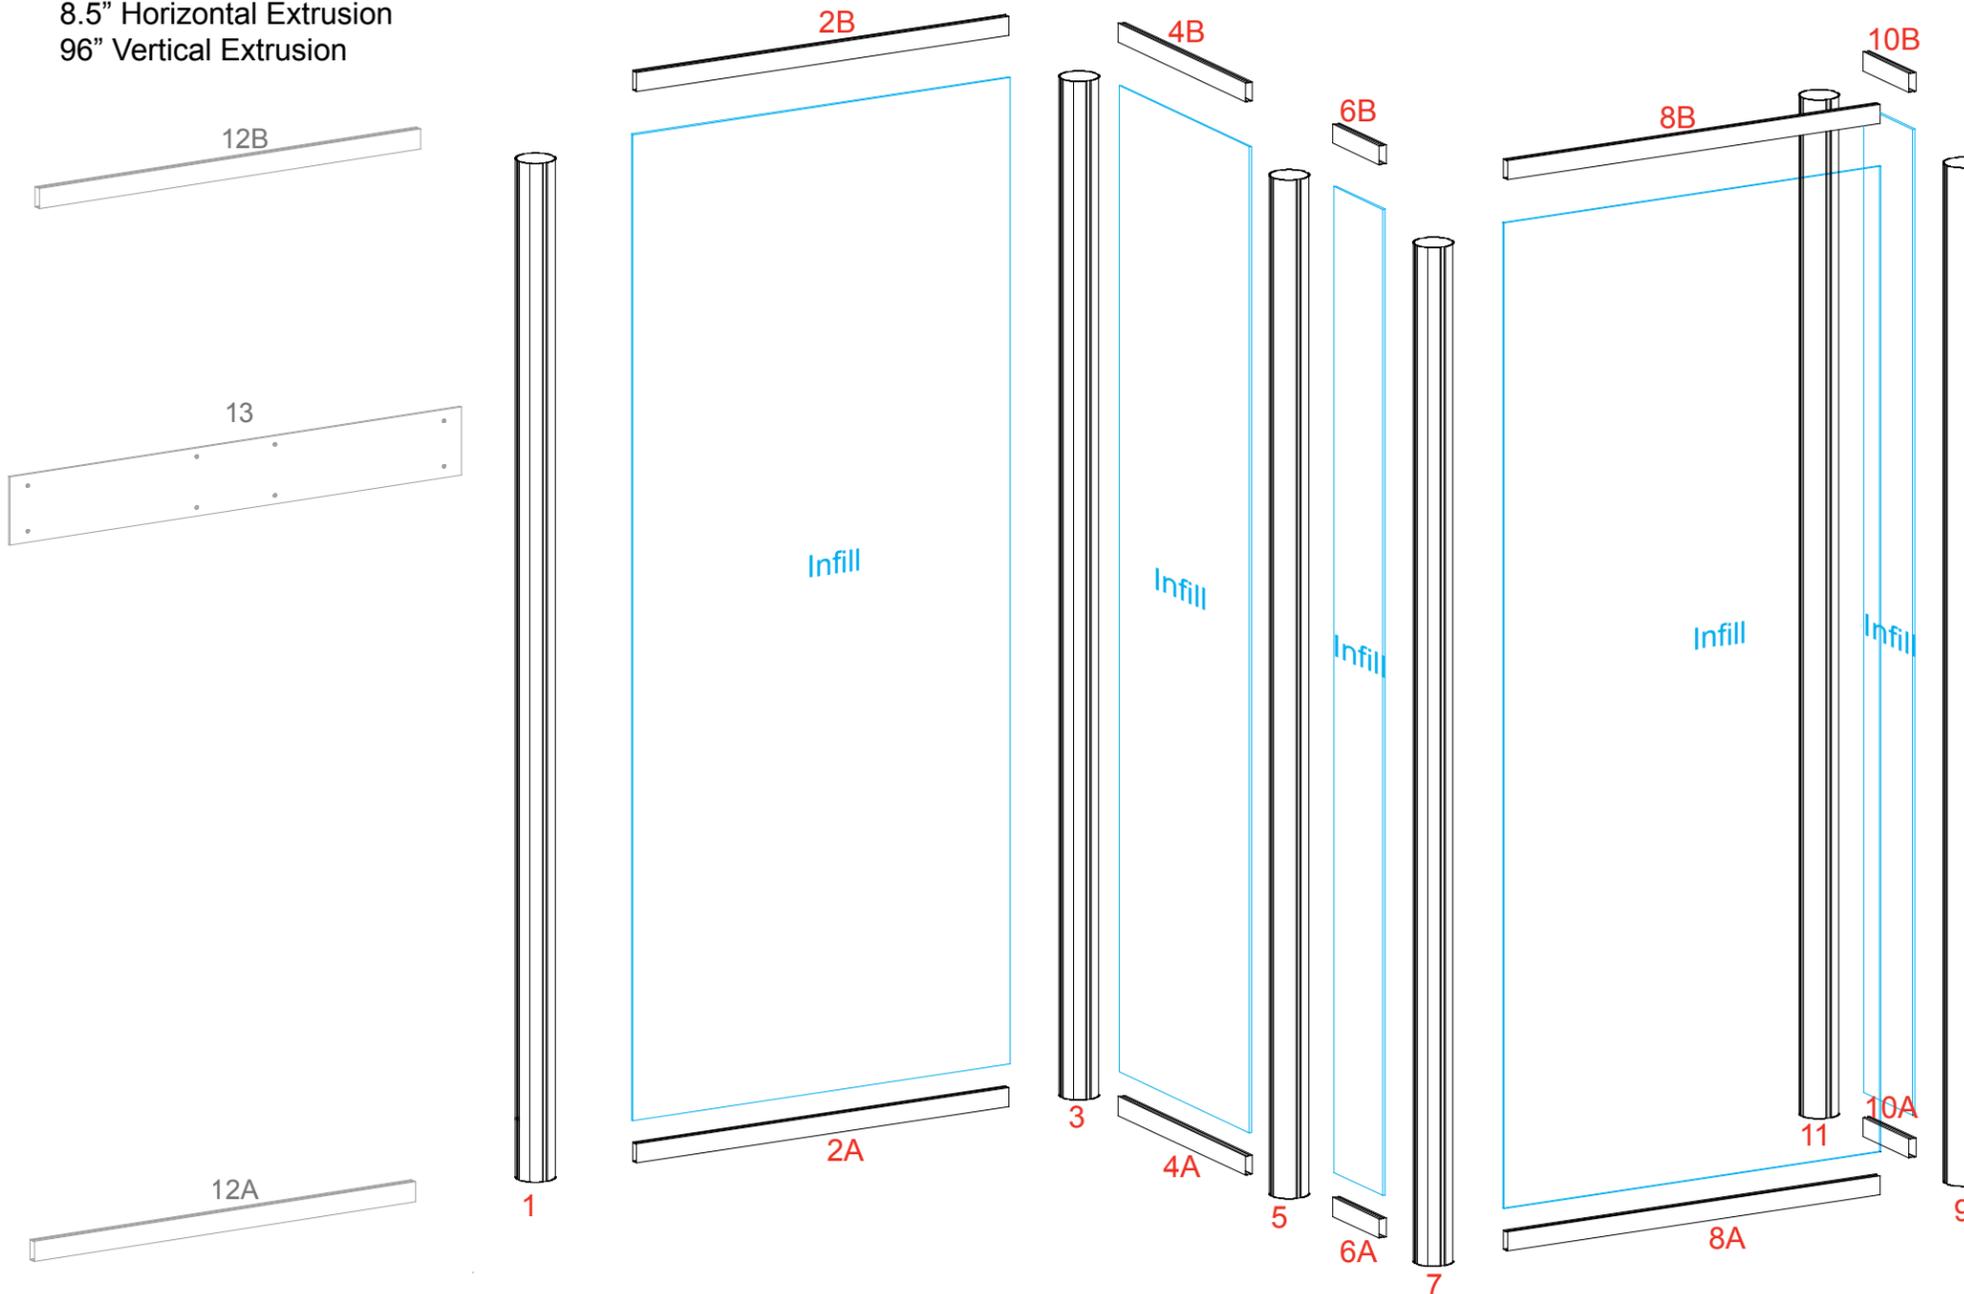


**RIGHT SIDE**

Steps:

- 1) Connect shelves, ceilings, wings, and monitor mount to assembled backwall  
(See details on following page).

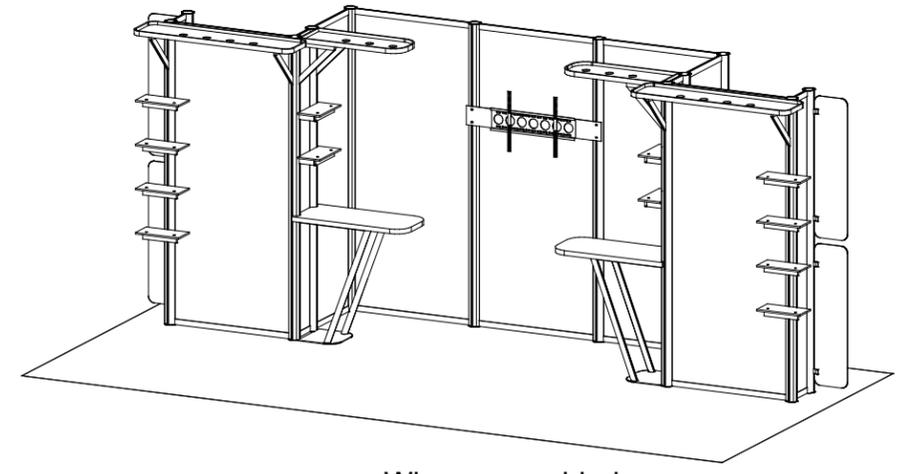

When assembled

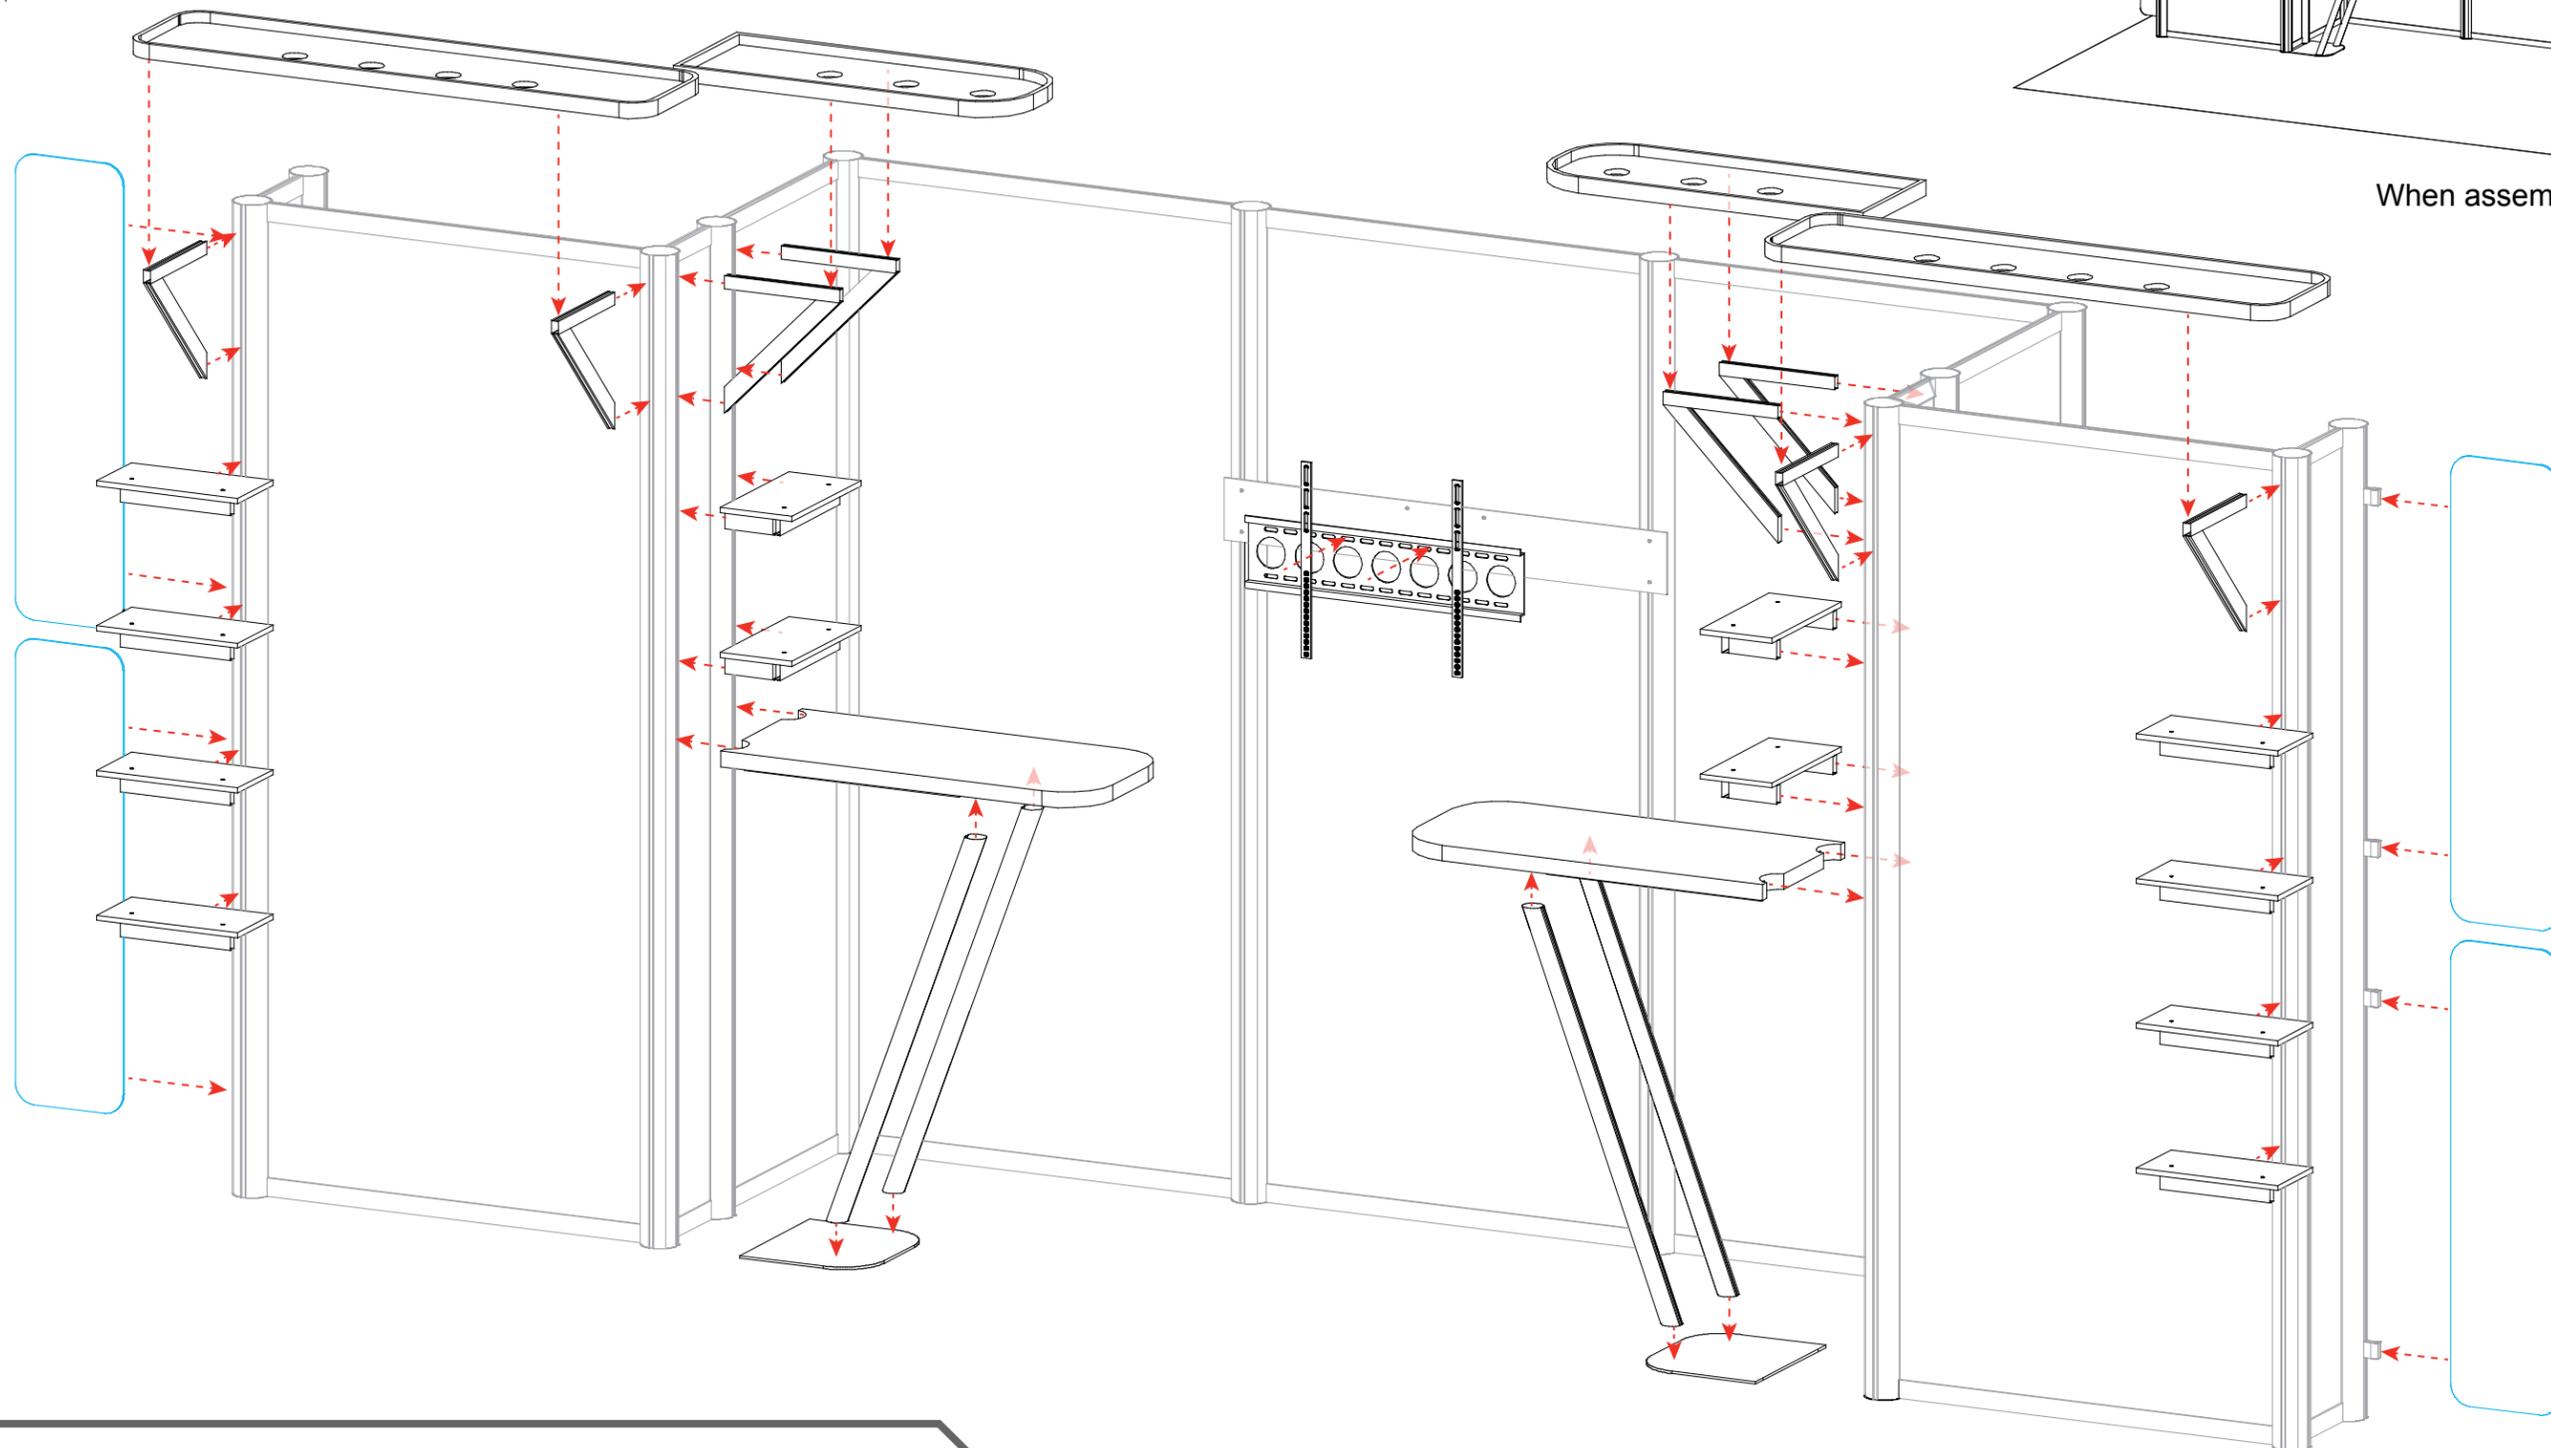

**A10 Clamp Detail**

- 1) Slide A10 connector into groove of extrusion.
- 2) Tighten set screw to secure A10 to extrusion.
- 3) Insert Infill into Clamp
- 4) Tighten knob to secure wing in place.

**Ceiling Attachment**

**Monitor Mount Attachment**

- 1) Slide mounting connector pieces into groove of extrusion. Tighten setscrew to secure in place.
- 2) Attach mounting plate to verticals as shown.
- 3) Then attach wall plate to plate using bolts and wing nuts

**\* Shelf Attachment**

Insert lock into groove of vertical extrusion and tighten setscrew.

Back of Shelf



Setscrew will face outward for ease of assembly

Lock

Setscrew

Steps:

- 1) Connect legs to bottom of pedestal.
- 2) Connect countertop to top of pedestal with standoffs and standoff caps.
- 3) Connect front graphic to front of pedestal with standoffs and standoff caps.

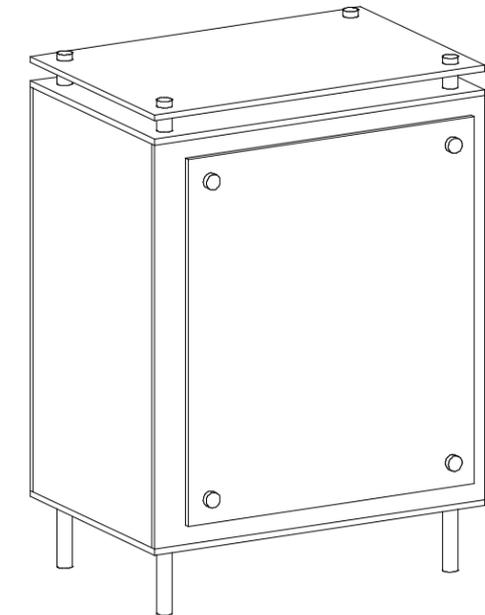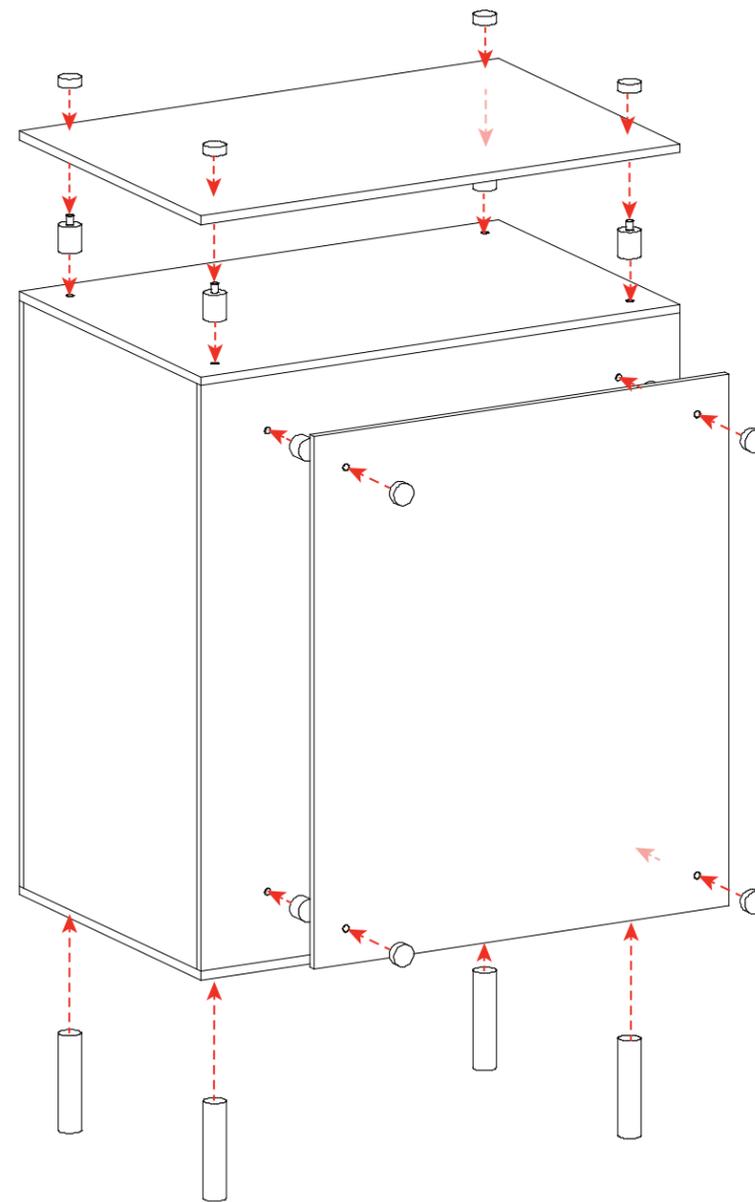

When assembled